

ENGINEERING DOCUMENTATION

Frameless Torque Motor

Dimensional & Integration Guide

DOCUMENT	REVISION / ISSUE	STATUS
DIG-ES-FM-U01-OD060-TOP45NM-001	DRAFT-08 / 27 Aug 2026	Engineering Integration Reference

Integration Overview


Frameless torque motor for direct integration into a host rotary assembly. This guide supports rotor-stator alignment, air-gap control, bearing and load-path design, thermal extraction, electrical integration and staged commissioning.

Key Integration Facts


INTEGRATION ITEM	PUBLISHED VALUE
Rated Torque	0.45 Nm
Rated Speed	3100 rpm
Body Outer Diameter	60 mm
Rotor Inner Diameter	28 mm
Axial Stack Length	12 mm
Weight	0.24 kg

Product Structure & Views


These views present product structure, mounting interfaces and relevant integration geometry for this SKU.

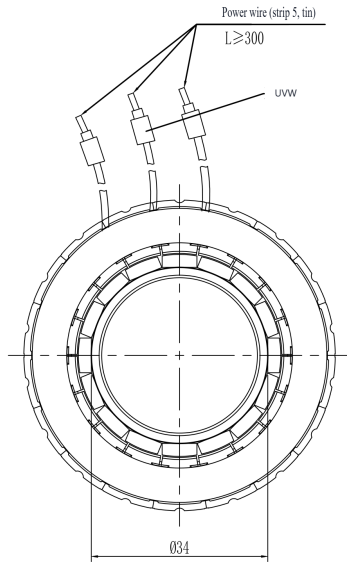

Mechanical View 2

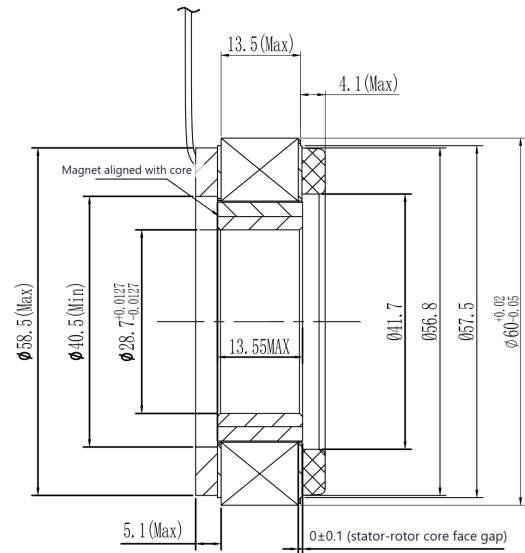

Mechanical View 4

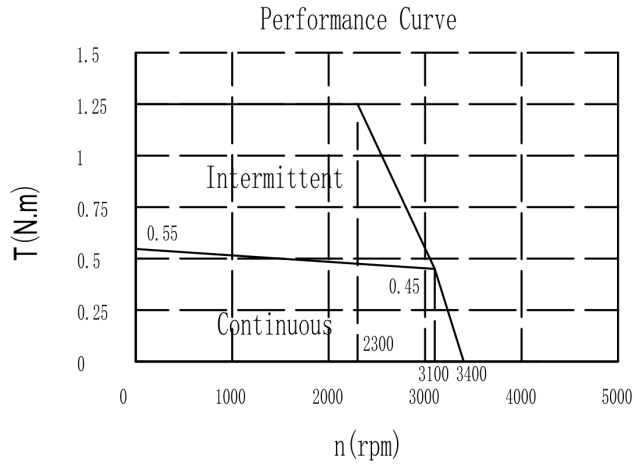

Mechanical View 5

VIEW	FIELD	VALUE
Mechanical View 2	Power wire processing note	Power wire, strip length 5 mm, tin dip
	Phase wire identification	UVW phase identification
	phase power wire	UVW phase label
	Power wire length	L>=300
Mechanical View 4	Upper axial maximum dimension	13.5 max
	Right-side axial maximum dimension	4.1 max
	Magnet-to-core alignment requirement	Magnet aligned with core
	Maximum outside diameter	Diameter 58.5 max
	Minimum diameter	Diameter 40.5 min
	Diameter 28.7 tolerance	Diameter 28.7 with +0.0127/-0.0127 tolerance
	Inner axial maximum dimension	13.55 max
	Diameter 41.7	Diameter 41.7
	Diameter 56.8	Diameter 56.8
	Diameter 57.5	Diameter 57.5
	Diameter 60 tolerance	Diameter 60 with +0.02/-0.05 tolerance
	Lower axial maximum dimension	5.1 max
	Stator-rotor core face gap	0 ±0.1 stator-rotor core face gap
Mechanical View 5	Chart title	Performance Curve
	Torque axis unit	Torque T in N.m
	Speed axis unit	Speed n in rpm
	Torque scale values	Torque ticks: 0, 0.25, 0.5, 0.75, 1, 1.25, 1.5 N.m
	Speed scale values	Speed ticks: 0, 1000, 2000, 3000, 4000, 5000 rpm
	Intermittent operation curve label	Intermittent operation region
	Continuous operation curve label	Continuous operation region
	Continuous torque callout	Continuous torque callout: 0.55 N.m
	Torque breakpoint callout	Torque breakpoint callout: 0.45 N.m
	Speed characteristic points	Speed characteristic points: 2300, 3100, 3400 rpm

Overall Dimensions and Mounting Interface

PARAMETER	PUBLISHED VALUE	UNIT
Body Outer Diameter	60	mm
Rotor Inner Diameter	28	mm
Axial Stack Length	12	mm

- Confirm the stator, rotor, bore, axial stack, locating and retention geometry against the applicable exact-SKU drawing.
- The host housing and shaft must provide the required datum control without distorting the active motor components.

Rotor, Stator and Air-Gap Alignment

PARAMETER	PUBLISHED VALUE	UNIT
Rotor Inner Diameter	28	mm

- Control concentricity, axial position, runout and operating air gap through the complete tolerance and temperature range.
- Prevent contact, magnetic debris, impact and assembly forces from damaging the rotor or stator.

Bearing, Load Path and Retention

PARAMETER	PUBLISHED VALUE	UNIT
Rotor Inertia	0.127	kgcm ²
Weight	0.24	kg

- The host bearing system must carry radial, axial and moment loads; do not infer bearing capability from motor torque or diameter.
- Provide positive rotor retention and verify overspeed, imbalance, shock and fault torque cases.

Electrical and Feedback Integration

PARAMETER	PUBLISHED VALUE	UNIT
Torque Constant	0.124	Nm/A
Number of Pole Pairs	8 pole pairs	

- Match the winding, drive current, voltage, commutation and feedback system to the exact SKU.
- Use current phase, sensor and insulation definitions; do not infer pin or phase identity from this guide.

Thermal Path and Duty Cycle

PARAMETER	PUBLISHED VALUE	UNIT
Rated Torque	0.45	Nm

- Design a verified heat path from the stator into the host structure and validate temperatures under the intended duty cycle.
- Peak torque and current are transient boundaries and require coordinated drive protection.

Assembly and Commissioning Validation

PARAMETER	PUBLISHED VALUE	UNIT
Rated Speed	3100	rpm
Rated Torque	0.45	Nm

- Check free rotation, air gap, retention, insulation and sensor alignment before energization.
- Commission at low energy, confirm commutation and direction, then validate the complete joint through intended load and fault cases.

Integration Checklist

- | | |
|----|--|
| 01 | Confirm the exact SKU, 2D package and applicable assembly data. |
| 02 | Verify stator, rotor, bore, stack, datums, retention and operating air gap. |
| 03 | Validate host bearings, shaft, housing stiffness, runout and thermal growth. |
| 04 | Confirm winding, drive, feedback, commutation and insulation compatibility. |
| 05 | Establish and validate the stator-to-housing thermal path. |
| 06 | Check free rotation and insulation before low-energy commissioning. |
| 07 | Validate full load, speed, temperature and credible fault cases. |

[View SKU Product Datasheet](#) [Request controlled 2D drawing](#) [Request controlled STEP review](#) [Request a Quote](#)

Engineering Use and Verification Notice

01. This Dimensional & Integration Guide applies only to EmbodyStack SKU ES-FM-U01-OD060-TOP45NM-001 and is intended for dimensional evaluation and preliminary integration. It is not a applicable manufacturing drawing, wiring definition, application approval, machinery risk assessment, safety validation or integration planning document. Before design freeze, machining, wiring or energization, verify all dimensions, tolerances, mounting and locating features, load boundaries, electrical interfaces, thermal conditions, cabling, grounding, protection, commissioning and applicable regulatory requirements against the applicable EmbodyStack engineering data for this exact SKU. Where this guide and applicable product documentation differ, the applicable product documentation governs. Validate the complete installed system under intended duty cycles, loads, accelerations, environmental conditions and credible fault cases.