ENGINEERING DOCUMENTATION

Rotary Servo Motor

Dimensional & Integration Guide

DOCUMENT	REVISION / ISSUE	STATUS
DIG-ES-SM-L03-180G-V96-T19P1NM-4000W-001	DRAFT-08 / 27 Aug 2026	Engineering Integration Reference

Integration Overview

Closed-loop rotary servo motor for specified motion axes. This guide supports mechanical mounting, shaft and coupling integration, feedback and brake planning, cable routing, thermal validation and staged commissioning.

Key Integration Facts

INTEGRATION ITEM	PUBLISHED VALUE
Rated Torque	19.1 N·m
Rated Speed	2000 rpm
Rated Voltage	96 VDC
Flange Size	180 mm

Product Structure & Views

These views present product structure, mounting interfaces and relevant integration geometry for this SKU.

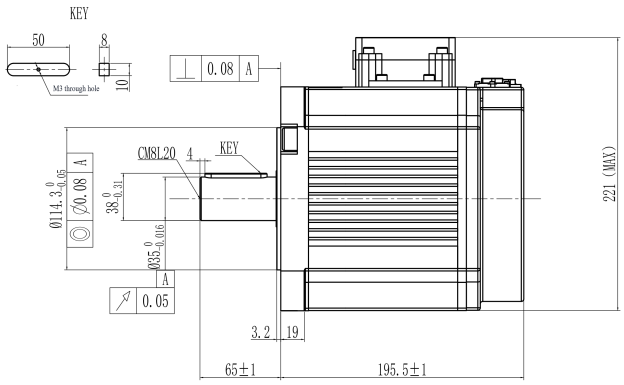

Mechanical View 1

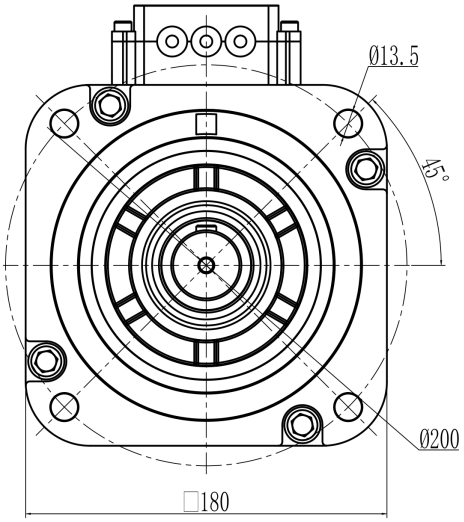

Mechanical View 2

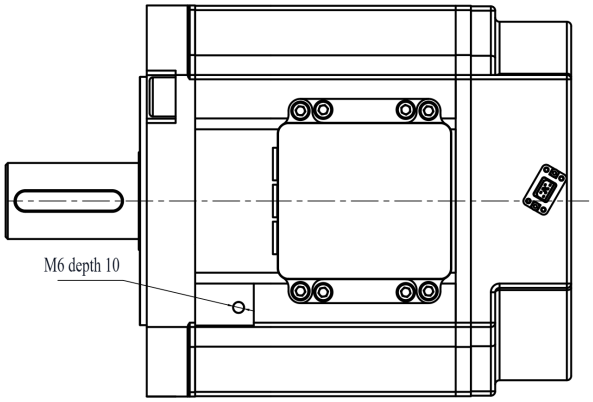

Mechanical View 3

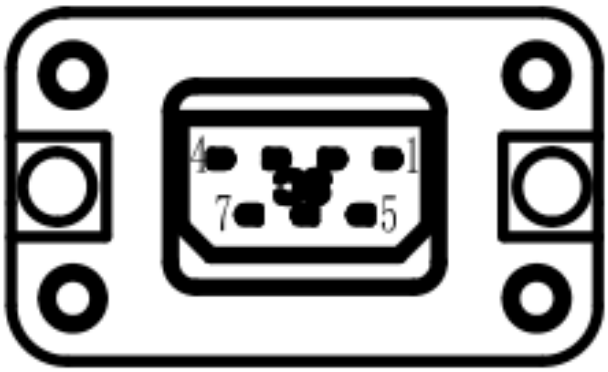

Mechanical View 6

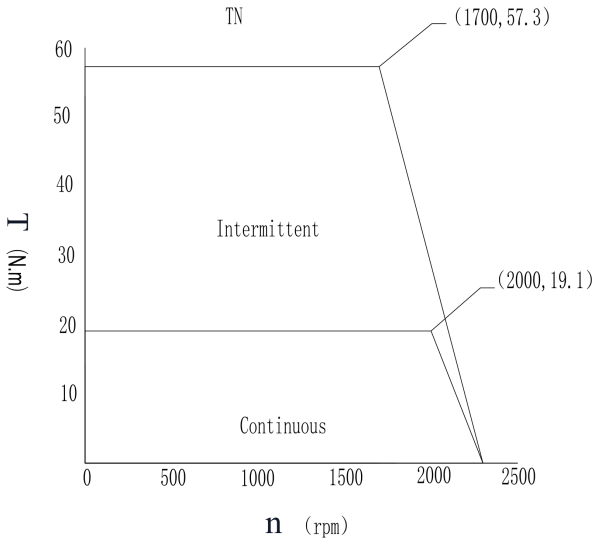

Mechanical View 9

VIEW	FIELD	VALUE
Mechanical View 1	Key length	50 mm
	Key width	8 mm
	Key depth	10 mm
	Through hole specification	M3 through hole
	Position tolerance	Position tolerance Ø0.08 relative to datum A
	Main shaft diameter with tolerance	Ø114.3 +0/-0.05 mm
	Secondary shaft section diameter with tolerance	Ø38 -0.31 mm
	Shaft end diameter with tolerance	Ø35 0/-0.016 mm
	Datum A	Datum A
	Flatness tolerance	Flatness 0.05 mm
	Quantity or designation	4
	Axial mounting dimension 1	3.2 mm
	Axial mounting dimension 2	19 mm
	Mounting reference distance 1	65±1 mm
	Total mounting length	195.5±1 mm
	Maximum height	221 mm (MAX)
	Perpendicularity tolerance	Perpendicularity 0.08
Mechanical View 2	Mounting hole diameter	Ø13.5 mm
	Mounting hole angular position	45°
	Flange diameter	Ø200 mm
	Square flange side length	180 mm
Mechanical View 3	Mounting hole specification	M6 threaded hole, depth 10 mm
Mechanical View 6	Connector pin number	Pin label: 4
	Connector pin number	Pin label: 7
	Connector pin number	Pin label: 1
	Connector pin number	Pin label: 5
Mechanical View 9	Chart title	TN curve chart
	Y-axis label	Torque T (N·m)
	X-axis label	Speed n (rpm)
	Y-axis scale values	Torque axis values: 0, 10, 20, 30, 40, 50, 60 N·m
	X-axis scale values	Speed axis values: 0, 500, 1000, 1500, 2000, 2500 rpm
	Curve characteristic point 1	At 1700 rpm, torque is 57.3 N·m
	Curve characteristic point 2	At 2000 rpm, torque is 19.1 N·m
	Operating zone labels	Intermittent duty zone (upper region) and Continuous duty zone (lower region)

Overall Dimensions and Mounting Interface

PARAMETER	PUBLISHED VALUE	UNIT
Flange Size	180	mm

- Confirm the mounting face, locating feature, shaft geometry, fastener engagement and removal clearance against the applicable exact-SKU drawing.
- Mount the motor on a flat, rigid interface and avoid using fasteners to pull a misaligned assembly into position.

Shaft, Coupling and Load Path

PARAMETER	PUBLISHED VALUE	UNIT
Rotor Inertia	66.43( ) / 62.34	Kg·cm2

- Align the driven shaft and coupling before tightening; validate radial, axial and moment loads against applicable bearing-load data.
- Do not hammer, uncontrolled press-fit or transmit installation force through the motor bearings.

Electrical, Feedback and Brake Integration

PARAMETER	PUBLISHED VALUE	UNIT
Rated Voltage	96	VDC

- Use only the current winding, feedback, brake and connector definitions for this exact SKU.
- Verify drive compatibility, polarity, current limits, feedback direction and brake sequencing before enabling torque.

Thermal, Duty and Environmental Conditions

PARAMETER	PUBLISHED VALUE	UNIT
Rated Torque	19.1	N·m
Operating Temperature	-20 to 40	°C

- Validate winding and housing temperature under the installed duty cycle, ambient condition, mounting heat path and enclosure airflow.
- Published peak values are transient boundaries and must not be treated as continuous operating ratings.

Cable Routing, Grounding and EMC

- Provide strain relief and bend radius through the full machine motion envelope.
- Separate motor power, brake and feedback wiring and terminate shields according to the specified system grounding architecture.

Commissioning and Motion Validation

PARAMETER	PUBLISHED VALUE	UNIT
Rated Speed	2000	rpm
Rated Torque	19.1	N·m

- Commission at low energy with the transmission unloaded or safely restrained, then confirm direction, feedback polarity, brake final integration, current limit and fault response.
- Validate the complete axis through intended acceleration, speed, load, stop and fault cycles during integration planning.

Integration Checklist

01	Confirm the exact SKU, 2D drawing and applicable wiring data.
02	Verify mounting, shaft, coupling, alignment, fasteners and removal clearance.
03	Validate radial and axial loads, inertia, acceleration and credible shock cases.
04	Confirm drive, winding, feedback, brake and connector compatibility.
05	Set current, speed, acceleration and thermal limits from the installed duty cycle.
06	Verify cable routing, shielding, grounding, strain relief and bend radius.
07	Commission at low energy before validating the full machine cycle.

View SKU Product Datasheet Request controlled 2D drawing Request controlled STEP review Request a Quote

Engineering Use and Verification Notice

01. This Dimensional & Integration Guide applies only to EmbodyStack SKU ES-SM-L03-180G-V96-T19P1NM-4000W-001 and is intended for dimensional evaluation and preliminary integration. It is not a applicable manufacturing drawing, wiring definition, application approval, machinery risk assessment, safety validation or integration planning document. Before design freeze, machining, wiring or energization, verify all dimensions, tolerances, mounting and locating features, load boundaries, electrical interfaces, thermal conditions, cabling, grounding, protection, commissioning and applicable regulatory requirements against the applicable EmbodyStack engineering data for this exact SKU. Where this guide and applicable product documentation differ, the applicable product documentation governs. Validate the complete installed system under intended duty cycles, loads, accelerations, environmental conditions and credible fault cases.